Tech Note 063 Nissan Navara Installation Tips

Ref: TN063

Issue date: July 2015

Issue number: 2

Crank Angle Sensor Damage

It has been reported that the crank angle sensor can easily be damaged upon removal of the transmission from this vehicle.

To avoid potential damage occurring it is therefore important to remove the crank angle sensor prior to transmission removal.

Failure to do so may result in either engine misfire or the engine failing to start as a consequence of the damaged sensor.

Crankshaft Bolt Torque Setting

The replacement crankshaft bolts supplied for this vehicle application should be tightened to the following torque specification.

108 Nm

